
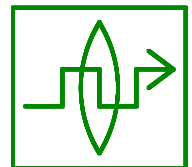


| Test point | DC Voltage |
|---------------------------------|-----------------------|
| P51 receiving packet | 0V |
| P51 receiving no packet | P74 |
| P52 | 0V |
| P53 | P74-0.2V...P74 |
| P54 | P74-0.9V...P74-0.6V |
| P55 | P74-0.1V...P74 |
| P57 | 11.5V...12.5V |
| P60, P61 receiving packet | P74-0.28V...P74-0.22V |
| P60, P61 receiving no packet | P74 |
| P63 | 1.9...2.3V |
| P64 | 0V |
| P66,P71 transmitting packet | P742-0.1V...P742+0.1V |
| P66,P71 not transmitting packet | 0...P74 |
| P67 | 0.454*P74 |
| P68, P69 receiving packet | 0V |
| P68, P69 receiving no packet | P74 |
| P72 receiving packet | 0V |
| P72 receiving no packet | 0.46*P74 |
| P73 receiving packet | P74 |
| P73 receiving no packet | 0V |
| P74 | 4.8V...5.2V |

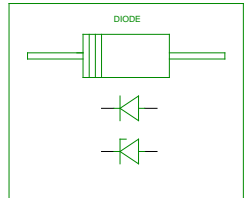

RONJA

Ronja AUI Forte

| | | | |
|-------|---------------------|-----------|----------------|
| TITLE | Licensed under GFDL | REVISION: | April 19, 2005 |
| FILE | | DRAWN BY: | Clack |
| PAGE | 1 | OF | 1 |